 
 


Installation guide


1. Cut the end of strain relief boot to fit your cable OD.




2. Insert cable into strain relief boot, strip off 1.2 inch of cable jacket, fold back braid and drain wire.



3. Stick the correct wiring label on the wire cap if it is not T568B way.

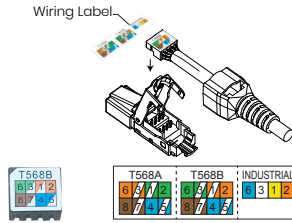

 Wiring cap
 (Default with
 T568B wiring label)





Wiring label

JACK PIN DESIGNATIONS

	T1A / E 1A T568A	T1A / E 1A T568B	INDUSTRIAL
1	White/ Green	White/ Orange	Yellow/ Orange
2	Green	White/ Green	White/ Orange
3	White/ Orange	White/ Green	White/ Blue
6	Orange	Green	
4	Blue	Blue	
5	White/ Blue	White/ Blue	
7	White/ Brown	White/ Brown	
8	Brown	Brown	

 4. Fan out all four twisted pairs, following the wiring label and allocate each conductor into proper slots on wiring cap. Trim the ends of conductors.

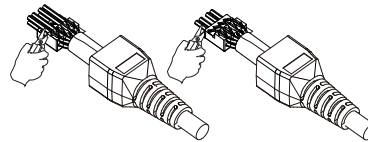


T568B
 T568A
 INDUSTRIAL




T568B
 T568A
 INDUSTRIAL

5. Place the wiring cap onto plug, use plier to clamp wiring cap until it completely snap-in to effect the connection.

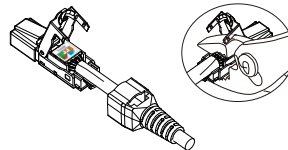


6. Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug. Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.

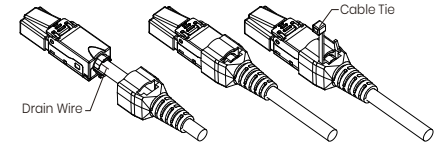


Unload the cable

Cut off cable tie, remove the boot. Using flat screw driver and pry gently on plug cover one end first and the other end subsequently to open it.

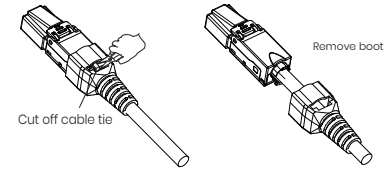

Cut off cable tie

Remove boot

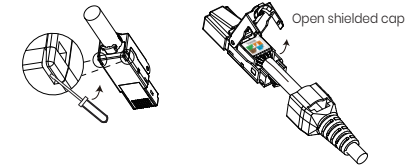

Open shielded cap

